


Körnungslinie

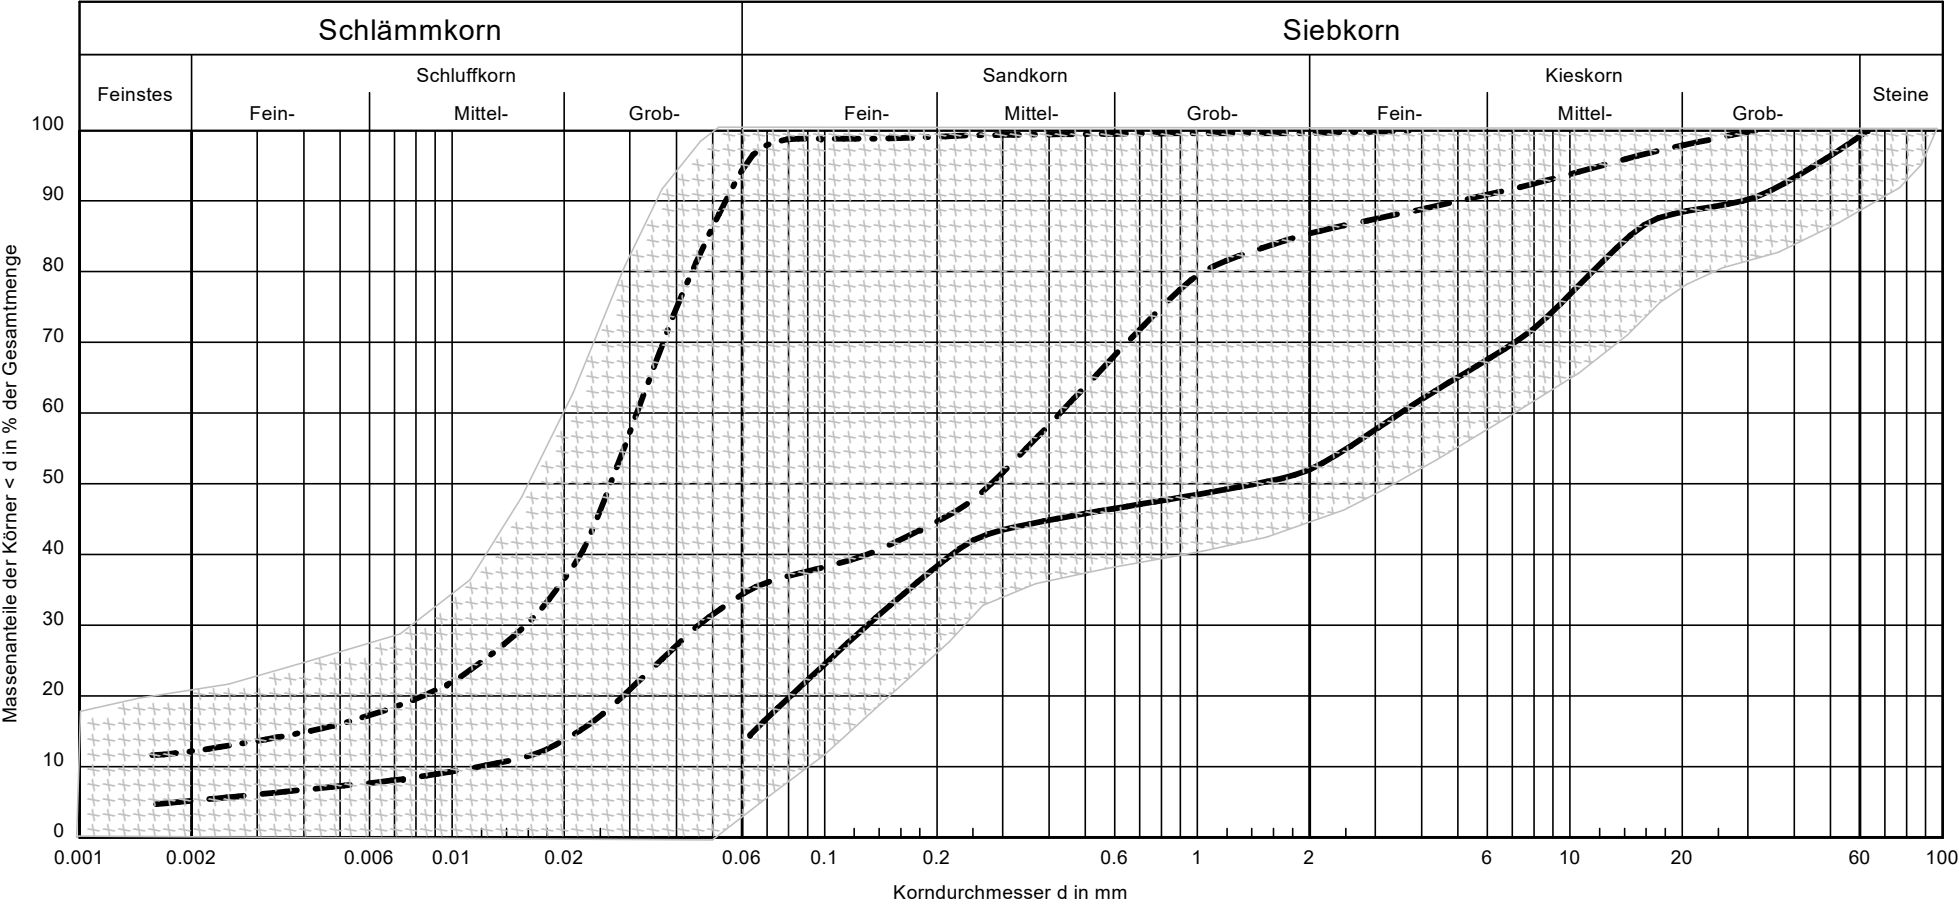


|                     |                  |                  |           |
|---------------------|------------------|------------------|-----------|
| Labor-Nr.           | 7288             | 7289             | 7290      |
| Entnahmestelle      | RKS 4            | RKS 2            | RKS 4     |
| Entnahmetiefe ( m ) | 1,7 - 2,8        | 0,2 - 1,0        | 0,0 - 0,7 |
| Bodenart            | A (G, u', s̄), k | A (S, ū, g', h) | A (U, t') |
| Wassergehalt ( % )  | 6,0              | 12,2             | 14,9      |
| Signatur            | ————             | -----            | - . - . - |

GRUNDBAUINSTITUT BIEDEBACH  
Hellerstraße 21  
44229 Dortmund  
www.gbdo.de

Bearb. - Nr.: 3079  
Anlage - Nr.: 1/3.1

Körnungslinie

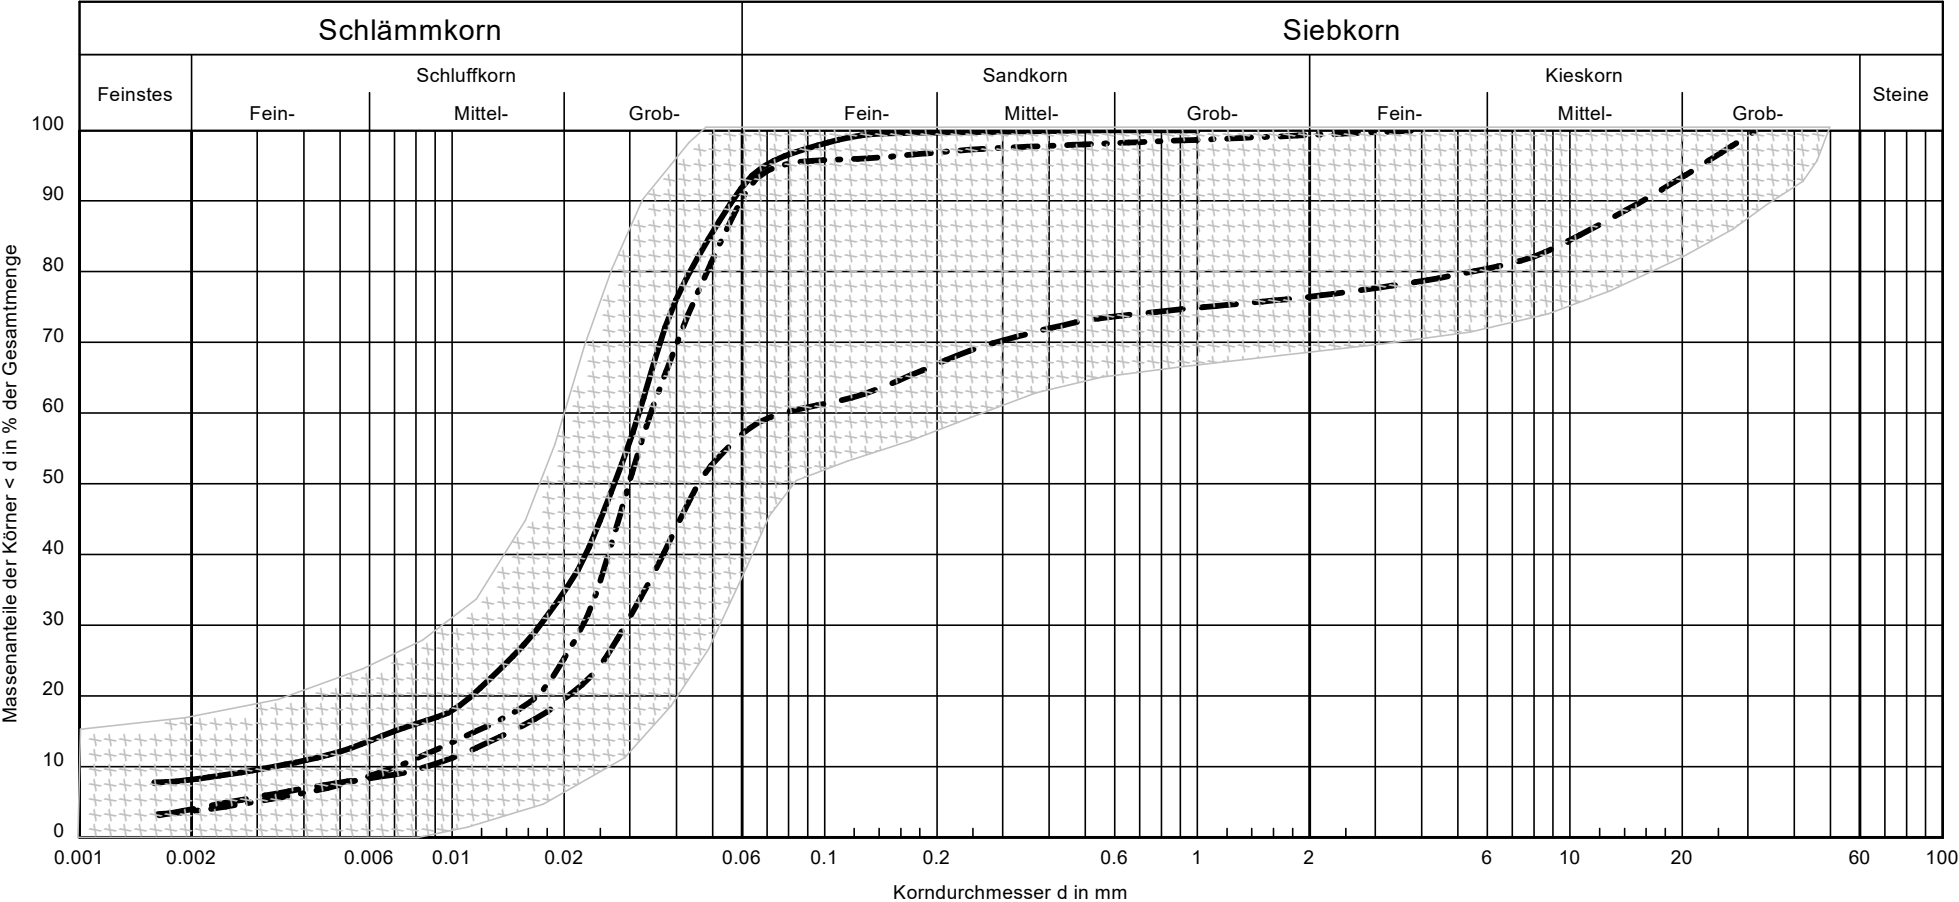

|                     |            |            |           |
|---------------------|------------|------------|-----------|
| Labor-Nr.           | 7291       | 7292       | 7293      |
| Entnahmestelle      | RKS 5      | RKS 1      | RKS 3     |
| Entnahmetiefe ( m ) | 1,3 - 2,2  | 4,0 - 4,8  | 4,6 - 5,6 |
| Bodenart            | gU, t', s' | U, s, g, k | gU, s'    |
| Wassergehalt ( % )  | 14,8       | 16,4       | 21,0      |
| Signatur            | — — — —    | - - - -    | - . - .   |

GRUNDBAUINSTITUT BIEDEBACH  
Hellerstraße 21  
44229 Dortmund  
www.gbdo.de

Bearb. - Nr.: 3079  
Anlage - Nr.: 1/3.2