


Körnungslinien

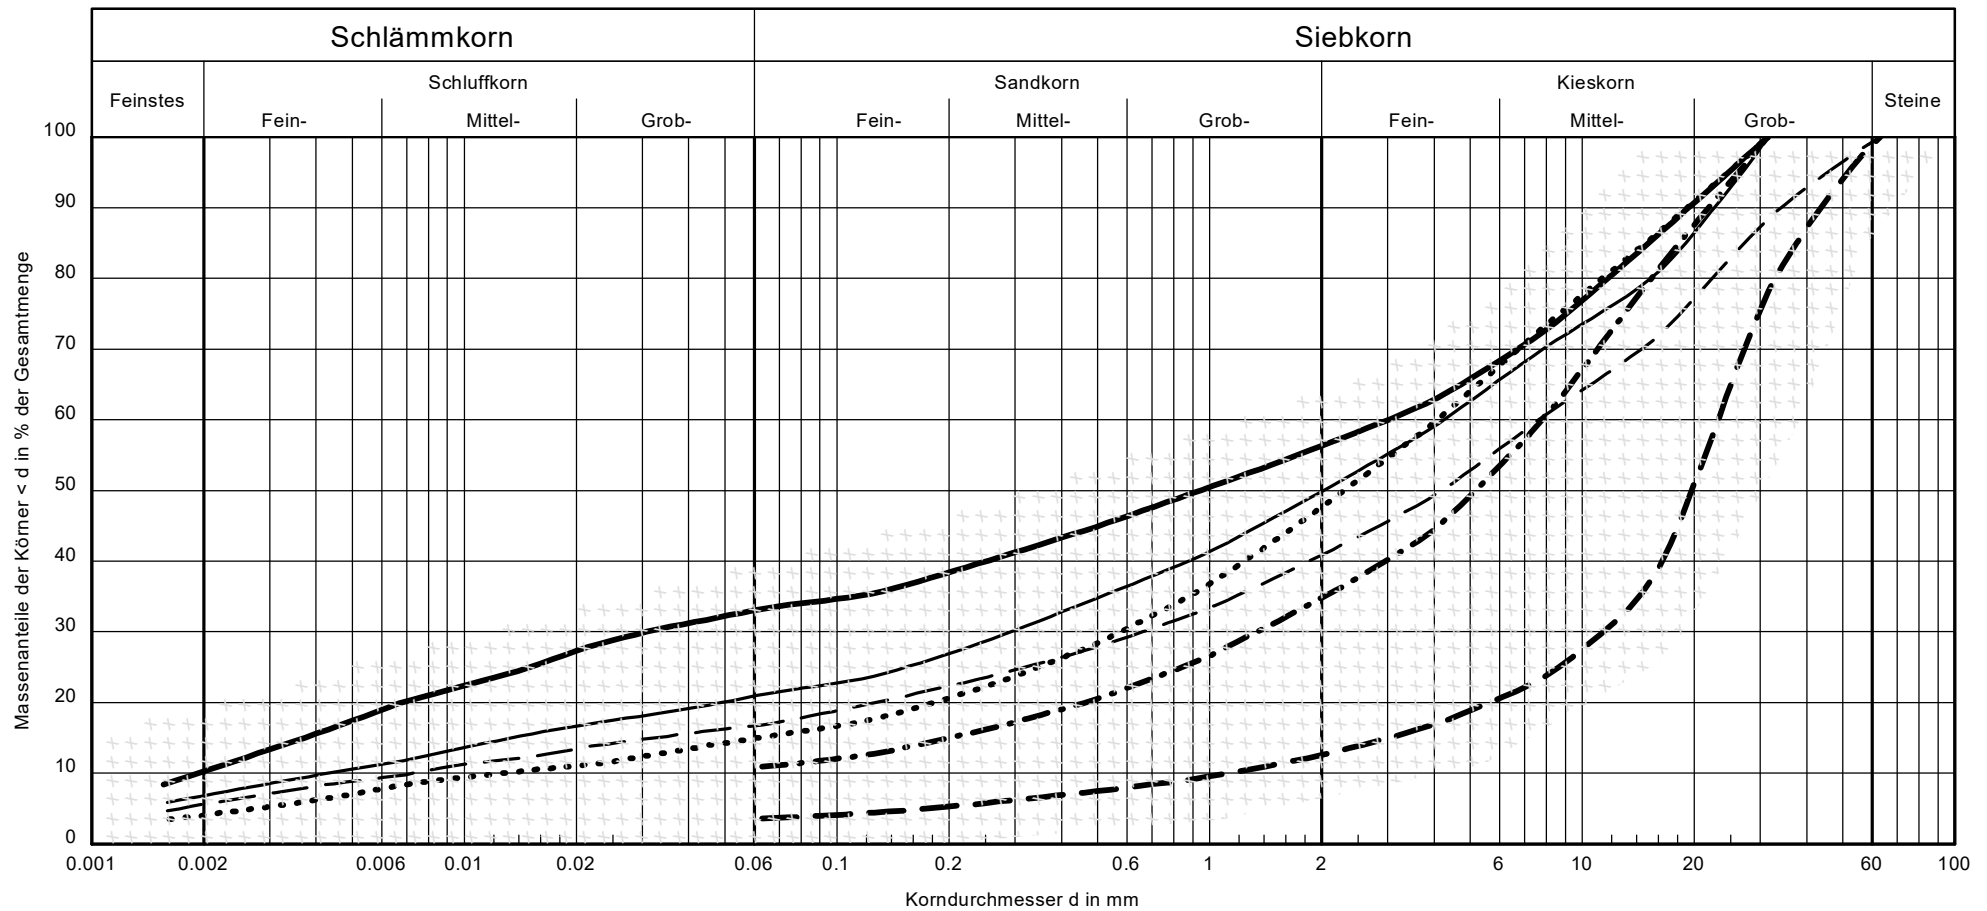

Labor-Nr.	6775	6776	6777	6778	6779	6780
Entnahmestelle	RKS 1	RKS 3	RKS 5	RKS 7	RKS 9	RKS 11
Entnahmetiefe (m)	0,4 - 2,0	0,4 - 2,0	0,4 - 2,0	0,4 - 2,0	0,0 - 1,0	0,0 - 1,0
Bodenart	A (G, $\bar{u}$, s)	A (G, s')	A (G, u', s)	A (G, u', $\bar{s}$)	A (G, u, s)	A (G, u, s)
Wassergehalt (%)	11,3	2,9	5,7	9,0	6,0	7,4
Signatur	— — — — —	— — — — —	— — — — —	— — — — —	— — — — —	— — — — —
Cu/Cc	1558.4/0.2	20.6/5.0	-/-	323.8/6.5	989.5/4.7	1045.7/7.8

GRUNDBAUINSTITUT BIEDEBACH
Hellerstraße 21
44229 Dortmund
www.gbdo.de

Bearb. - Nr.: 2831/A
Anlage - Nr.: 2 / 4